



RENAULT CONFIDENTIAL

MÉGANE II RS

Type	Fabrication cut-offs			
BM1 V	K 261043	to	K 261800	
BM1 W	K 261045	to	K 261804	
BM1 1	K 261058	to	K 261649	
CM1 L	K 264897	to	K 266397	
CM1 V	K 264315	to	K 266427	
CM1 W	K 264312	to	K 266430	
CM1 1	K 264538	to	K 264538	
CM2 H	K 264311	to	K 266435	
CM2 J	K 265385	to	K 266098	

59A ISOFIX SEAT MOUNTING
OTS: 0AYC MARK: L2

Other sub-section concerned: **999**

Basic manual:
Driver's Handbook: 687 - 10

The vehicle fabrication cut-offs are given as examples only.
IMPORTANT: check before starting any operation that the vehicle is affected by OTS: 0AYC.

• Countries with PGCS

Network with ICM:	Refer to the "List of OTS operations to be carried out" in ICM.
Network without ICM:	Check box L2 on the blue label. <ul style="list-style-type: none">• If the box is not marked with a cross Contact your primary network to consult the "List of OTS to be carried out" in ICM.

• Countries without PGCS

All networks:	Check box L2 on the blue label. <ul style="list-style-type: none">• If the box is not marked with a cross The vehicle is affected.
---------------	---

"The repair procedures given by the manufacturer in this document are based on the technical specifications current when it was prepared.

The procedures may be modified as a result of changes introduced by the manufacturer in the production of the various component units and accessories from which the vehicles are constructed."

All rights reserved by **RENAULT S.A.S.**

Copying or translating, in part or in full, of this document or use of the service part reference numbering system is forbidden without the prior written authority of **RENAULT S.A.S.**

TECHNICAL INFORMATION

Preventive operation

- Fitting of mounting rings.

Objective

- To fit the 3rd anchoring point of the Isofix seat.

Marking the vehicle after work has been carried out

- Affix a blue label to the front driver's side shock absorber turret:

Part no.: 49 39 031 089.

- Mark a cross in box L2 using a marker pen.


Description of the operation

FITTING OF MOUNTING RINGS

IMPORTANT

It is **ESSENTIAL** to observe the 21 N.m tightening torque of the right-hand and left-hand ring bolts specified in the Technical Note.


- Open the tailgate.

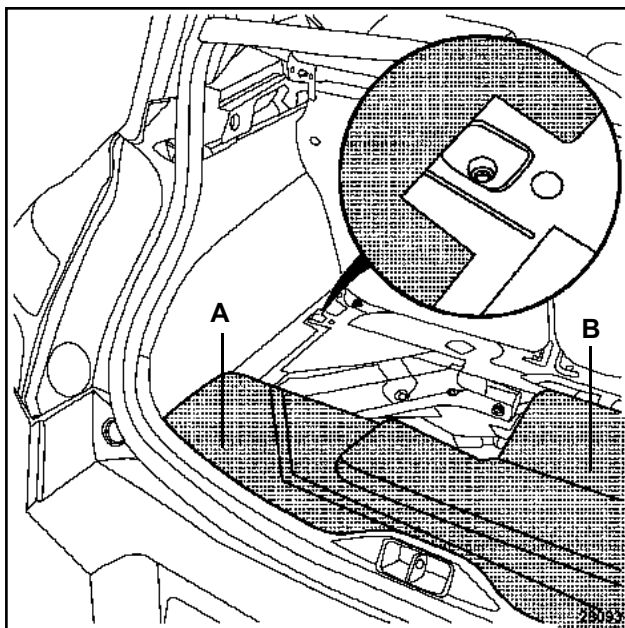

A – Luggage compartment carpet

B – Emergency spare wheel storage compartment carpet

- Lift up:
 - the rear section of the luggage compartment carpet (A),
 - the emergency spare wheel storage compartment carpet (B).
- Fold back:
 - the rear section of the luggage compartment carpet (A),
 - the emergency spare wheel storage compartment carpet (B).

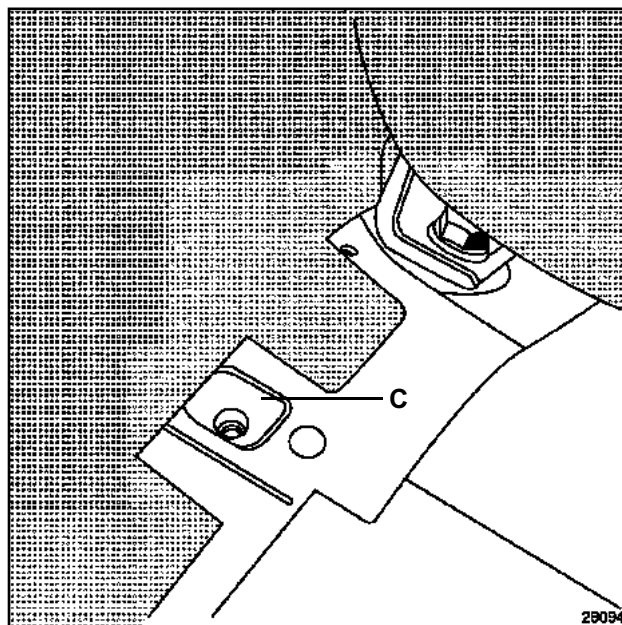


C – Mounting ring positioning area

- Fit the right-hand and left-hand side mounting rings in area (C).


Note

The mounting (D) must be located near the rear bench seat backrest (E), and the removable ring (F) near the rear of the luggage compartment.

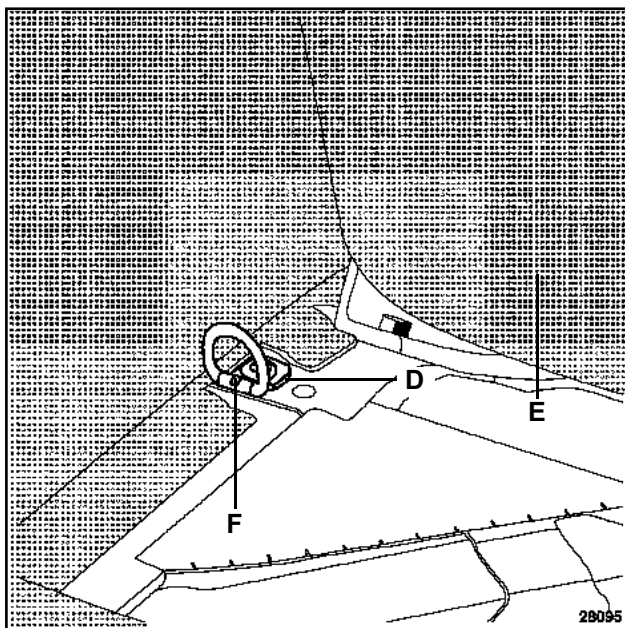

- D – Mounting
E – Rear bench seat backrest
F – Removable ring

- Fit the right-hand and left-hand mounting rings.
- **Torque tighten the bolts to 21N.m.**
- Unfold the carpets.
- Pull the mounting rings through the openings in the luggage compartment carpet.

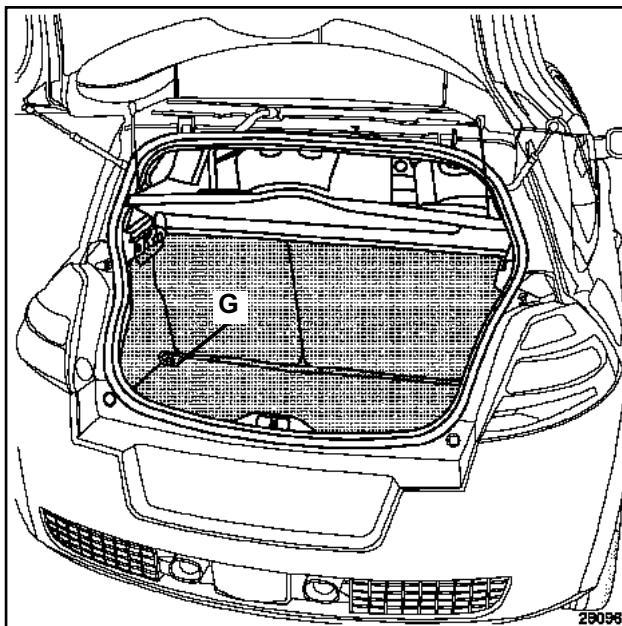

- G – Openings in the carpet

- Close the tailgate again.
- End of operation.

CLAIM COMPLETION AND CODING

When to take action

- When a recall letter has been sent to the customer and/or the first time the vehicle is brought into the workshop.

Parts required

Quantity and description of parts		Part number
2	Mounting rings	82 00 476 449
2	CBLX M10-33 1 bolt	77 03 006 341

Tooling required

- Conventional.

Time required

Code	Description	Time
0096	Application of OTS	0.2
7602	OTS Fitting of mounting rings	0.2
TOTAL		0.4

Destination of removed parts

- In accordance with warranty directives.

Accounts procedure

- In accordance with warranty directives.

OTS code: OAYC (0 = Zero)
– Closure date: Unlimited.